
SUMMARY OF REPAIRS AND MAINTENANCE

UNIT: 33

- JUNE 2022 REPAIR ENGINE INJECTOR ISSUES SUMMIT MOTORS INV 03W2753
- DEC 2021 REPLACE AIR TANK SUMMIT MOTORS INV 03P15470
- SEPT 2021 REPLACE PTO HOPF MECHANICAL INV 17463
- APR 2021 DELETE DEF D.C HEAVY DUTY MECHANICAL INC INV 2488
- MAR 2021 ROUGH ENGINE DIAGNOSIS AND REPAIR SUMMIT MOTORS INV 03W1618
- FEB 2021 AIR UP AIR TANKS AND REPLACE TRAILER LIGHTS PG MECHANICAL INV 7380
- MAR 2019 REPLACE IMT SENSOR AND IPR VALVE SUMMIT MOTORS INV B15154
- MAR 2019 REPAIR HYDRAULICS AND REBUILD PTO HOPF MECHANICAL INV 9409
- MAR 2019 CHANGED THERMOSTAT AND BELTS. IN HOUSE MECHANIC
- SEPT 2018 CLEAN OUT DPF AND DOC SUMMIT MOTORS INV B14752
- APR 2018 REPLACE WINDSHIELD BROOKS CAR CARE INV 01-24724





CERTIFICATE NUMBER

Commercial Vehicle Inspection Certificate Traffic Safety Act

PART 1 - VEHICLE OWNER AND VEHICLE IDENTIFICATION

Vehicle Ty	oe:	Truck				Seating	g Cap	acity	/ :					
GVW:		22600	kg			Brake	Туре			Air				
Owner Nan	Owner Name: Big Steam Oilfield Service					Ltd								
Address: Po Box 789														
City: Brooks				Prov	vince: AB Postal Cod			al Code:	T1R	1B7				
Telephone	Num	ber:	(403) 50	1-53	35									
Vehicle Ide	ntific	ation Nu	mber:		11-	HTWGAZ	R7DJ	3435	48					
Make:	li	nternatio	nal					Mod	del: 7	7000 Se	ries			
Year:	'ear: 2013							Uni	t Nun	nber:		33		
Odometer:	1	14139 KI	V	Lice	ence l	Plate Nu	mber		втт7	433		Province	p:	AB

IT IS AN OFFENCE TO FALSIFY AN INSPECTION CERTIFICATE

PART 2 - CERTIFICATION

I certify the vehicle described in Part 1 has passed the inspections and tests established under the Traffic Safety Act for a Commercial Vehicle.

Inspection Facility Name:		Facility Number:
Big Steam Oilfield Services	Ltd.	15339
Inspection Technician Name	9:	Technician Number
Pedro Reimer		B8398
Inspection Technician Signa	ature:	17/11
Inspection Date:	2022/04/07	



4801 46 Ave Taber, AB T1G 2A4 (403) 223-3563

Box 1630, 140-15 Ave E Brooks, AB T1R 1C4 (403) 501-5687

2050 South Hwy. Dr. SE Redcliff, AB T0J 2P0 (403) 548-6444

Invoice: 03W2753

Date / Hour: 6/23/2022 1:16:16PM

Repair Order: 2753 Customer: 22093 Branch: Brooks Total Invoice: \$2,623.63 ***Charge***

Page 1 of 2

Bill To:

BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7

701: 5 3 5055

GECEINED

Ship To: BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7

PAID .III 15 2022

Work: 403-501-5335

UNIT 33

jenn

Orig R/O:

6/23/2022

Unit Number: 33

Customer P/O:

Model Year: 2013

Completion Date:

Extended

\$1,444.70

\$2,623.63

Make/Model: INTERNATIONAL 7400

Type: TRUCK

VIN: 1HTWGAZR7DJ343548

Meter: 114303 Kilometers

ECM Reading: 5766

In-Service Date: 03/27/2019

Unit Components:

Manufacturer

Model

Part Number MAXXFORCE 9 Serial Number

570HM2Y3436056

Task:

12

ENGINES

Department: Service

Complaint: CUSTOMER STATES UNIT HAS INJECTOR ISSUES

Correction: Hooked up laptop to unit; two active codes for injectors. Performed relative compression test and found number 6 to be low. Ran through a buzz test and number 1 and 6 failed. Removed components to gain access to valve cover, removed valve cover, removed high pressure rail, removed injector harness and removed both injectors. Sucked out all oil in cylinder, installed two new injectors with lube on the o-rings, torqued hold downs to 30lbft and high pressure rail to 22lbft. Installed new o -rings on injector rail and re installed all components. Vacuum filled coolant system, ran test once unit got to temp;no leaks or issues present. Repairs verified and no further issues found.

Supp.	Part		¥.	Description / Ref Number	U/M	Quantity	Price	Price
		1842626C96		SEAL, KIT, HP OIL RAIL SEALS	EA	1.0	\$128.76	\$128.76
		5010717R91		INJECTOR, 1334, 570, REMAN	EA	2.0	\$644.72	\$1,289.44
		5010717R91-C		CORE	EA	2.0	\$368.94	\$737.88
		5010717R91-C		CORE	EA	-2.0	\$368.94	(\$737.88)
		762964PK		ZIP TIE, 14", 50# STRENGTH	EA	15.0	\$0.56	\$8.40
		762968PK		ZIP TIE, 14", 120# STRENGTH	EA	5.0	\$0.84	\$4.20
		SH550057739		ROTELLA ELC NF 50/50 CASE 6 1	EA	1.0	\$13.90	\$13.90
		Shop Sup		Shop Supplies		1.0	\$91.44	\$91.44

GST/HST Number: 136235181

Detail Tax Info:

GST Sales Tax \$124.94 \$0.00

Total:

\$124.94

Total Core Charge: \$737.88 **Total Core Ret:** (\$737.88)**Total Labor:** \$962.55 **Total Miscellaneous:** \$91.44 Invoice Subtotal: \$2,498.69 **Total Tax:** \$124.94

Payment Method

Terms Charge Net 30 Due Date 7/23/2022

ENTERED 1111 0 7 2022

Total Parts:

Total Invoice:

4801 46 Ave Taber, AB T1G 2A4 (403) 223-3563

Box 1630, 140-15 Ave E Brooks, AB T1R 1C4 (403) 501-5687

2050 South Hwy. Dr. SE Redcliff, AB T0J 2P0 (403) 548-6444

Invoice: 03P15470

Date / Time: 12/18/2021 9:21:29AM

Parts Order: 15470 Customer: 22093

Branch: Brooks

Invoice Total: \$526.97 *** Charge *** Page 1 of 1

BIII To: BIG STEAM OILFIELD SERVICES **BOX 789** BROOKS, AB T1R 1B7

RECEIVED

DEC 2 0 2021

Ship To: BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7 Office Phone: 403-501-5335

payables@bigsteamoilfield.com

Customer P/O: unit:33	Invoiced By: dylanc	Delive	ery Method: Cu	stomer Pickup		
			0	17-4	Dile	Ext
Part / Misc	Description / Ref Number	U/M	Quantity	List	Price	Price
3558527C1	CABLE TANK MTG*ASSY SURGE TANK	EA	2	\$35.71	\$35.28	\$70.56
172.5979	AIR TANK IHC 3832979C1	EA	1	\$431.32	\$431.32	\$431.32
			Bin Loc	ation: SP		

GST/HST Number:

136235181

ENTERED DEC 2 8 2021

Detail Tax Info:

GST Sales Tax

\$25.09 \$0.00

\$25.09 Total:

> Invoice Subtotal: **Total Tax:**

\$501.88 \$25.09

Invoice Total:

\$526.97

Payment Method:

Charge

Payment Terms: Net 30

Due Date: 01/17/2022

Remit To: Summit Motors Ltd. 4801 46th Avenue Taber, AB T1G 2A4

PAID JAN 2 6 2022

ALL OVERDUE ACCOUNTS ARE SUBJECT TO A LATE CHARGE OF 2% PER MONTH (26.82% PER ANNUM)

PLEASE NOTE DELETED ENGINES DO NOT QUALIFY FOR ANY WARRANTIES

Signature:

480146 Ave Taber, AB T1G 2A4 (403) 223-3563

Box 1630, 140-15 Ave E Brooks, AB T1R 1C4 (403) 501-5687

2050 South Hwy. Dr. SE Redcliff, AB T0J 2P0 (403) 548-6444

Invoice: 03P15381

Date / Time: 12/15/2021 8:24:53AM

Parts Order: 15381 Customer: 22093 Branch: Brooks Invoice Total: \$675.76 *** Charge ***

Page 1 of 1

Bill To: BIG STEAM OILFIELD SERVICES **BOX 789** BROOKS, AB T1R 1B7

RECEIVED

DEC 1 5 2021

Ship To: BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7 Office Phone: 403-501-5335

payables@bigsteamoilfield.com

Customer P/O: 33	Invoiced By: dylanc	Deliv	ery Method: Cu	stomer Pickup		
Part / Misc	Description / Ref Number	U/M	Quantity	List	Price	Ext Price
3832983C1	TANK AIR PRESS PRIMARY - STEEL	EA	1	\$691.59	\$559.52	\$559.52
3832384C1	CABLE TANK MTG 32.0 IN	EA	2	\$42.55	\$42.03	\$84.06

ENTERED DEC 1 6 2021

GST/HST Number:

136235181

Detail Tax Info:

GST

Sales Tax

\$32.18 \$0.00 \$32.18

Total:

Invoice Subtotal:

\$643.58

Total Tax:

\$32.18

Invoice Total:

\$675.76

Payment Method: Charge

Payment Terms:

Net 30

Due Date:

01/14/2022

Remit To: -Summit Motors Ltd. 4801 46th Avenue

Taber, AB T1G 2A4

PAID JAN 2 6 2022

ALL OVERDUE ACCOUNTS ARE SUBJECT TO A LATE CHARGE OF 2% PER MONTH (26.82% PER ANNUM)

PLEASE NOTE DELETED ENGINES DO NOT QUALIFY FOR ANY WARRANTIES

Signature:

Please Remit To:

Gregg Distributors LP 16215 - 118 Avenue Edmonton AB T5V 1C7 Ph. (780) 4-GREGGS 447-3447 Fax (780) 451-2528

Gregg Distributors accepts payment via cheque, EFT, online bank transfer and Interac e-Transfer. Please follow this link for details: https://greggdistributors.ca/payments

INVOICE

GREGG DISTRIBUTORS LP
325 MACALPINE CRESCENT
FORT MCMURRAY, AB T9H 4Y4
(780)715-4000 FAX (780)743-8833



SEP 3 n 2021

_	BILL TO	CUSTOMER NO.	SALESMAN NO.	SHIP TO	CUSTOMER NO.	SALESMAN NO.				
r	BILL 10	640570	FTA		640570	FTA	PG	1	OF	1
	BIG ST BOX 78 BROOKS	201 March 1981 - 10-10-10-10-1		BIG STI BOX 789 BROOKS			6405 0012			

									GST Nu	ımbe	r: R	83439585	57	11	NVOICE NUMBER
GR	ŒG	G DIST	RIB	UTOI	RS, FI	MC	MUR	RAY	CHARGE	E	I	NVOICE			7-262843
MO. D		YR. PREPAR	RED BY	OUR O	RDER NU	MBER	Y	OUR ORD	ER NUMBER	1	TERMS	30 DAYS		PED VIA	MER PICKUP
9/2	9/				33437	6	UNI	T31		-	_	LIST	NET.		EXTENDED
QTY. ORDEREI	D	QTY. SHIPPED		ERED	PROD. ABBR.	1	PART	NUMBE	R DESCRIPTION	N	CODE	PRICE	PRICE		AMOUNT
BEN															
											TG	132.300	92.7	0.0	92.70
	1	1			PPL	HAW	1-22	2-20 18	.9L AW22	2 HY			E		
	1	1			***	EHC	-AB	-306	-L		TG		0.9		0.95
	_					-			.92 LITE	RE C	A CONTRACTOR OF THE PARTY OF TH	.H.C.	0.9		0.95
	1	1	. .		***	EHC	C-AE	3-306	-C .92 L C	ገእየሞሽ	TG	EHC	U.9		0.93
	1	1			EVE	HDI	OIN3		. 92 11 00	J14 11.	TG	40.59	25.0	10	25.01
	_	_						HD	VISION	+ I	ED H	EADLIGH!	r E		
						(SOOD	S &	SERVICES	S TA	x (c	ODE G)	Ş	5.98	3
												5			
													FAITEF	E 0	ACT 8 / 2021
													ENIER	EU	OCT 0 4 2021
												51			
									1						
								11		5					
								114							
								V							
		****	*		1		24					estern C	anada,	. 1	*****
TOTAL BOX		AAA COIL B	DL RE	EL BRL	Greg		is CKED BY	A.11 -1-1-	ad to be	et he ma	de within	5 days of	SUB TO		119.61
JOAL JOA								receipt o	f goods. Back orde	eturned	for credit a	are subject to	TAX		5.98
		OTHER				SHIF	PED BY	resaleabl	ig charge and musile condition, and acice number. 2% per m) charged on ove	r month	11ed by (24%	16:25	TOTAL		125.59
								po. umiu							

Hopf Mechanical & Hydraulics

660 Aquaduct Dr Box 1658 Brooks, AB T1R 1C5

403-501-0190 403-501-8466

RECEIVED

OCT 0 6 2021 Invoice To Big Steam Oilfield Services Box 789 Brooks, AB T1R 1B7

Invoice # Date 17463 2021-09-27

Invoice



W.O. No.	P.O. No.	Terms
10177		NET 45

admin@hopfmechanical.com

www.hopfmechanical.com

admin@nopimechani	cal.com www.i	портпеснательной			
Item	Quantity	Description		Price Each	Amount
REGULAR TIME BUYOUT BUYOUT BUYOUT FREIGHT SHOP	12 1 1 1 1	REGULAR TIME SHOP 380GGFJP-B5RH PTO ASSEMBLY P560971 TRANS FILTER ATFP20 SYNTHETIC BLEND FREIGHT CHARGE Shop Supplies/Enviro Charges UNIT# 33 PTO/PUMP INOP REMOVE PTO. DISASSEMBLE TO CLUTCHES ARE NOT REPAIRAB SERVICE ALLISON TRANSMISSIFLUSH. TEST.	O INSPECT. LE. REPLACE PTO.	118.00 2,687.555 122.395 442.00 54.97 113.28	1,416.00 2,687.56 122.40 442.00 54.97 113.28
		PAID	OCT 1 9 2021	ENTERED	OCT 0 7 2021
				Subtotal	\$4,836.21
CCT/UST No	822076766	1		Sales	Tax Summary

GST/HST No.

822076766

GST@5.0% Total Tax

241.81 241.81

Total

\$5,078.02

BEARING SPECIALISTS AND A WHOLE LOT MORE BOX 970, 1160 - 2ND ST WEST BROOKS, ALBERTA TIR 0V5

Auto Parts Professionals

Phone: 403 362-6208

Sold to: BIGSTOI

BOX 789

Fax: 403.362.6270

BUMPER TO BUMPER



Shipping paid by:

Ship to: SAME

BROOKSALBERTA T1R 1B7

BIG STEAM OILFIELD SERVICE

	Item	Description	Ordered	Shipped	List \$	Unit \$	Extended \$
PNE- PNE- FAR- FAR- WAT-	MJTV-3 1461D 1469-4A PC1469-5/32A A281BB	3 WAY POPPET TOGGLE VLV TOGGLE VALVE-AIR-4WAY 1/4TUB-1/8NPT 90L AIR BR 5/32T X 1/8 MPT90 DOUBLE PALM goods and services tax	1.00 1.00 4.00 2.00 1.00	1.00 1.00 4.00 2.00 1.00	69.66 110.46 2.78 6.90 5.50 8.44	55.73 88.37 2.33 5.78 3.75 8.44	55.73 88.37 9.32 11.56 3.75 8.44

RECEIVED OCT 0 4 2021

ENTERED OCT 0 4 2021

PAID 0CT 1 9 2021

INVOICE

24-Sep-2021

P.O. # Unit 31

Salesman: AJ

Page 1 of 1

572653

Buyer:

Ship Via:

Stocked Items	Non- Stocked	Cores	Enviro Charges	Misc Charges	Other . Charges	GST	PST	Payments	Document Total
168.73	0.00	0.00	0.00	0.00	0.00	8.44	0.00	0.00	177.17
MON	DAY - FRIDAY FURDAY: 7:00			ORIZED SIGNATU	M		Email: c		IES
	GST # 802765	297 RT							

D/C Heavy Duty Mechanical Inc

36 Sunset Cres SW Medicine Hat AB T1B 4T6 403-581-9885 dchd.mechanical@gmail.com RECEIVED

APR 1 ° 2021

Invoice

Date	Invoice #
2021-04-11	2488
Due Date	
2021-04-11	

Invoice To

BIG STEAM OILFIELD PO BOX 789 BROOKS, ALBERTA T1R1B7 CANADA

Vehicle Info

YEAR 2012

MAKE INTERNATIONAL

MODEL 7400

VIN 1HTWGAZR7DN343548

P.O. No.	KMS/ HRS	Unit#
	110826/5537	33

Item	Quantity		Description		Rate		Amount
Labour Labour	8.5 1	REMOY CANIS' REMOY OF PLA	VE EGR MIXING PIPE AN ATE AT REAR OF EGR CO ORCE 9 EGR OFF TUNIN	ID INSTALL BLOCK OOLER.	2,40	00.00 00.00 00%	850.00 2,400.00 162.50
		F	CHO 2024	2_	ERED A	PR 1 9	3 2021

GST/HST No.

804149326

All invoices are Due Net 30 days
Invoices past 30 days will be subjet to 2.99%
monthly

Subtotal	\$3,250.00
GST	\$162.50
Total	\$3,412.50



BROOKS

MEDICINE HAT

480146 Ave Taber, AB T1G 2A4 (403) 223-3563

Box 1630, 140-15 Ave E Brooks, AB T1R 1C4 (403) 501-5687

2050 South Hwy. Dr. SE Redcliff, AB T0J 2P0 (403) 548-6444

** Reprint **

Invoice: 03W1618

Date / Hour: 3/8/2021 3:17:26PM

Repair Order: 1618 Customer: 22093 Branch: Brooks Total Invoice: \$3,056.95

> ***Charge*** Page 1 of 2

Bill To:

BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7

RECEIVED

MAR 0 9 2021

Ship To: BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7

Work: 403-501-5335

ENTERED MAR 2 3 2021

Customer P/O:

jenn

Orig R/O: 0

Completion Date:

3/8/2021

Unit Number: 33

Model Year: 2013

Make/Model: INTERNATIONAL 7400

Type: TRUCK

Meter: 110811 Kilometers

VIN: 1HTWGAZR7DJ343548

ECM Reading: 5531

In-Service Date: 03/27/2019 Unit Components:

Manufacturer

Model

Part Number MAXXFORCE 9 Serial Number 570HM2Y3436056

Department: Service

ENGINES Task: 12 Complaint: CUSTOMER STATES UNIT RUNS ROUGH.

Correction: Tested injectors with buzz test with valve cover removed; found #2 injector to have no "buzz". Tested injector for resistance; injector was above spec. Removed HPOR and resealed it, installed new injector and torqued to spec. Reinstalled HPOR and torqued to spec, reassembled intake air and hooked up coolant lines, filled engine with coolant, zip tied hoses and wires out of the way. Ran engine checked for leaks/none found. Reset CEOM on injector, road test unit/CEL came on during acceleration on the turn around and unit lost boost. After test drive, topped up coolant and checked codes/found after treatment related code. Ran air management test and EGR valve was not responsive. Removed exhaust to look at DPF/DPF filter coming apart and needs replacement as engine de rates from excessive exhaust back pressure.

Cupp	Dort		Description / Ref Number	U/M	Quantity	Price	Price
Supp.	Part	1842626C96	SEAL,KIT, HP OIL RAIL SEALS	EA	1.0	\$119.58	\$119.58
		1888103C3	FITTING.THROTTLE COUPLING	EA	1.0	\$136.04	\$136.04
		2516013C91	TUBE,KIT, BOOST TUBE WITH CLAM	EA	1.0	\$101.77	\$101.77
		5010717R91-C	CORE	EA	-1.0	\$169.88	(\$169.88)
		3557856C1	CLAMP HEAT EXCHANGER	EA	1.0	\$51.65	\$51.65
		5010717R91	INJECTOR, 1334, 570, REMAN	EA	1.0	\$606.21	\$606.21
		5010717R91-C	CORE	EA	1.0	\$169.88	\$169.88
		SH550057733	RED 50/50 COOLANT	EA	1.0	\$9.90	\$9.90
		WU5490125	CLAMP, CO	EA	1.0	\$9.20	\$9.20
		ZBJ838003-1	1/4"" SPL	EA	2.0	\$0.16	\$0.32
		ZDEAM720	BRAKE CL	EA	1.0	\$5.08	\$5.08
		Shop Sup	Shop Supplies		1.0	\$162.38	\$162.38

GST/HST Number: 136235181

Detail Tax Info:

GST Sales Tax \$145.57 \$0.00 \$145.57 PAID APR 2 1 2021

Total Parts: Total Core Charge: \$1,039.75 \$169.88

Extended

Total Core Ret:

(\$169.88)

Total Labor:

\$1,709.25

Total Miscellaneous:

\$162.38

Total:

^{**} See Last Page for Invoice Total *

PG Mechanical & Services Ltd.

P.O. Box 4982 Fort Mcmurray AB T9H 3G2 pgmechanical@outlook.com http://www.pgmechanical.ca GST/HST Registration No.: 812762128RT0001



RECEIVED FEB 2 2 2021

INVOICE

BILL TO

Jeff Alberts Big Steam Oilfield Services Ltd. Po Box 789 Brooks Alberta T1R 1B7

ACTIVITY 135 Mechanical Feb 16, Shean, Lem # 9853 Unit # 33 - International - Air up air tanks - Put back on trailer - Repaired right rear trailer lights - Gave customer 2 windsheild washer to go Parts Windsheild Washer Heat Shrink Tube	QTY 1.50 2 5	RATE 135.00 3.99 0.50	AMOUNT 202.50 7.98 2.50	GST GST
10% Consumables	1	20.25	20.25	GST
		SUBTOTAL GST @ 5% TOTAL BALANCE DUE	\$2	233.23 11.67 244.90

ENTERED MAR 2 3 2021

BU

PAID MAR 2 3 2021

ERVICE	Check	Change	SERVICE	Check	Change
Body and Seats (S.1)			Wheel Alignment (S. 19)		
Chassis Frame (S. 2)			C-Dolly Steering (S. 20)		
Body Frame (S. 3)			Steering Linkage (S. 21)		
Sliding Subframe (S. 4)			Suspension (S. 22)		
Inderbody (S. 5)			General Requirements (S. 23)		
Oriver Shaft (S. 6)			Windshield Wipers and Washers		
Window and Mirrors (S. 7)			Anti-freeze (S. 24) Heating and Defrosting System		
Euel (S. 8)			(S. 25) Starting Switch (S. 26)		
Exhaust (S. 9)			Tires (S. 28)		
Friction Components (S. 10)			Wheels (S. 29)		
Hydraulic & Vacuum-assist Brake			Lubrication (S. 30)		
Components (S. 11) Mechanical Components (S. 12)			Fifth Wheel Coupling Device (S. 31)		
rake Pedal (S. 13)			Trailer Hitch, Mount & Connecting		
Air Brake System (S. 14)			Devices (S. 32) Rear Impact Guards (S. 33)		
Park Brake (S. 15)			Differentials		
Brake System (S. 16)			Transmission		
Engine Controls (S. 17)	•		Air Filter		
Steering Column and Box (S. 18)		No.	Engine Oil/Filter	¥	
Steering Column and Box (5. 18)			Positive Air Shut Off		
Back Up Alarm			Positive Air Shut On		

ERVICE	Check	Change	SERVICE	Check	Change
Body and Seats (S.1)	V		Wheel Alignment (S. 19)	V.	
Chassis Frame (S. 2)	/		C-Dolly Steering (S. 20)	NA	
Body Frame (S. 3)	1		Steering Linkage (S. 21)		
Bliding Subframe (S. 4)	NA	7	Suspension (S. 22)	~	/
Inderbody (S. 5)	/		General Requirements (S. 23)	1	
Oriver Shaft (S. 6)	V		Windshield Wipers and Washers Anti-freeze (S. 24)	/	
Vindow and Mirrors (S. 7)	1		Heating and Defrosting System (S. 25)	V	
uel (S. 8)		V	Starting Switch (S. 26)	V	
xhaust (S. 9)	V		Tires (S. 28)	V	
riction Components (S. 10)	/		Wheels (S. 29)	V	
lydraulic & Vacuum-assist Brake components (S. 11)	NA		Lubrication (S. 30)	V	
lechanical Components (S. 12)	V		Fifth Wheel Coupling Device (S. 31)	NA	
rake Pedal (S. 13)	~		Trailer Hitch, Mount & Connecting Devices (S. 32)	V	
ir Brake System (S. 14)	V		Rear Impact Guards (S. 33)	V	
Park Brake (S. 15)	~		Differentials	V	
Brake System (S. 16)	V		Transmission	V	
ingine Controls (S. 17)	V		Air Filter	V	
Steering Column and Box (S. 18)	V		Engine Oil/Filter		V
Back Up Alarm	V		Positive Air Shut Off	~	
NOTES: greased chec	kecl	fluick,	topped up diffs.		



Sold To:

Summit Motors Ltd.



Sold From:

BIG STEAM OILFIELD SERVICES

BOX 789

Since '63



Box 1630, 140 15th Ave E. Brooks, AB T1R 1C4

Phone: (403) 501-5687 Fax: (403) 501-5684

DATE: 05-14-19

Med Hat Brooks Branches: Taber

Ship To:

RECEIVED

PARTS INVOICE#

BIG STEAM OILFIELD SERVICES

PROOVE ARTIPIRT

BOX 789

B161621

MAY 1 6 2019

Page 1 of 1 Auth:

	BROOKS, AB TIR 1B7			BROOKS, AB IIR IB/					
C	Customer Acct Number	ra de la companya de	Phone Number	Salesman		Ship	Via	Customer Purch	ase Order
	22093	SERVICE VALUE OF SERVICE	403 501-5335	DC		CUSTOME	R PICK UP	UNIT:33	3
Loc	Part #		Description	Ord	Ship	B/0	List	Unit Price	Extension
08C07 FD3D	A5903 GEH6024	SPACER LAMP		14 2	14 2		8.74 23.44	7.28 19.53	101.92 39.06

ENTERED MAY 1 6 2019

ALL OVERDUE ACCOUNTS ARE SUBJECT TO A LATE CHARGE OF 2% PER MONTH (26.82% PER ANNUM). 11:11AM X X DC 32A1 PARTS TAX

PAID JUL 0 3 2019

VP294

				Sub Total	140.98
CUSTOMER SIGNATURE:		DATE:		Freight	0.00
	CUSTOMER			Sales Tax	0.00
				GST	7.05
	BIII		136235181	Please Pay	148.03

PRIVACY NOTICE

The personal information received from individuals relating to this transaction is collected in accordance with Dealers privacy policy. Its collection, use and disclosure is necessary for the purpose of repair, testing, service or other dealing with the Customers vehicle, for the use of any loaner vehicle. If applicable, and for providing information about other current and future products and services of the dealer, the manufacturer of new vehicles for which the dealer is franchised, and any applicable leasing or financing entity. The individual signing this agreement consents to such collection, use and disclosure. If the individual does not so consent or wishes to withdraw such consent, or if the individual wants a copy of the Dealers privacy policy, the individual must contact the dealers privacy officer.



Summit Motors Ltd.



Sold From:

Since '63



Box 1630, 140 15th Ave E.

Brooks, AB T1R 1C4

Phone: (403) 501-5687 Fax: (403) 501-5684

DATE: 04-17-19

Branches:

Sold To:

Lober

Brooks

Med Hat

Ship To:

RECEIVED

PARTS INVOICE#

BIG STEAM OILFIELD SERVICES APR 2 2 2019

BIG STEAM OILFIELD SERVICES

BOX 789

B160794

Page 1 of 1

Auth:

Odotomo: Note Hamilton		7	BROOKS, AB T1R	Auth:			
		er Phone Number	Salesman	Ship Via	Customer Purchase Order		
		403 501-5335	DC/DC	CUSTOMER PICK UP	UNIT:33		
Loc	Part #	Description	Ord Shi	o B/O List	Unit Price Extension		
FDFL	4057712C4 TCR6714583	SWITCH, TURN SIGNAL, W/HAZARD MUDFLAP, 24X30 PLAIN RUBBER	1 1 2 2	289. 2 14.			

PAID MAY 2 2 2019 VP266

ALL OVERDUE ACCOUNTS ARE SUBJECT TO A LATE CHARGE OF 2% PER MONTH (26.82% PER ANNUM).

08:52AM X X DC/ 9A1

PARTS TAX

ENTERED APR 2 2 2019

		-		Sub Total	265.13
CUSTOMER SIGNATURE:		DATE:		Freight	0.00
	cu	STOMER		Sales Tax	0.00
				GST	13.26
		BAIT	136235181	Please Pay	278.39

PRIVACY NOTICE

The personal information received from individuals relating to this transaction is collected in accordance with Dealers privacy policy. Its collection, use and disclosure is necessary for the purpose of repair, testing, service or other dealing with the Customers vehicle, for the use of any loaner vehicle. If applicable, and for providing information about other current and future products and services of the dealer, the manufacturer of new vehicles for which the dealer is franchised, and any applicable leasing or financing entity. The individual signing this agreement consents to such collection, use and disclosure. If the individual does not so consent or wishes to withdraw such consent, or if the individual wants a copy of the Dealers privacy policy, the individual must contact the dealers privacy officer.

Remit to: 4801-46 Ave. Taber, AB T1G 2A4



22093

Summit Motors Ltd.



Sold From:

Since '63



Box 1630, 140 15th Ave E. Brooks, AB T1R 1C4

Phone: (403) 501-5687 Fax: (403) 501-5684

MINIMAN

Branches: Laber Brooks Med Hat Customer: **BIG STEAM OILFIELD SERVICES** Ship To: **CUSTOMER INVOICE**

BOX 789

BROOKS, AB T1R 1B7 103 501 5335

BIG STEAM OILFIELD SERVICES INVOICE DATE: 03-21-19

BOX 789

BROOKS, AB T1R 1B7

Service Invoice #:

B15154

400	301 - 3333	Tax ID Date:	Tax ID:		Page 1 of 1
YEAR	MAKE / MODEL	VIN	LICENSE	MILEAGE	AUTH
2013	NAVISTAR / 7400	1HTWGAZR7DJ343548	BTT7433	97749	33
DEL DATE	OPEN DATE / TIME	ENGINE MODEL / SERIAL #	P.O. NUMBER	COMPLETE	UNIT/STOCK
09-13-12	03-19-19 / 08:10AM	MAXXFORCE 9 / 570HM2Y3436056	33	03-19-19	33
DEL MILEAGE		MEMO	TRANSMISSION MO	AND DESCRIPTION OF THE PARTY OF	SERVICE WRITER
21			1		AD*AD
ENGINE HOURS	4767.4	REEFER HOURS		TBY HOURS	7.07.0

CUSTOMER HAD TRUCK TOWED IN WARNING LIGHTS ON CORRECTION:

Customer had truck towed in, check complaint for warning lights on. Check codes, had faults for intake manifold pressure. Run to temp, check signals, found boost pressure not moving. Follow troubleshoot for faults, found intake manifold pressure sensor plugged and IPR valve shorted. Remove and replace IMT sensor and IPR valve. Perform regen. Clear codes, road test, engine lights are off. Release truck to customer.

> TOTAL LABOR TOTAL PARTS

4.9 HRS @ \$129.50 /HOUR =

\$545.98

Qty Part Number List Desc Unit Extended 1846481c92 118.34 SENSOR 97.00 97.00 1889325c95 KIT IPRV 448.98 448,98

SHOP SUPPLIES \$60.28 G.S.T. - REG. NO. 136235181 5.0 % OF \$1.240.81 = \$62.04

> SLS RETAIL LABOR \$634.55 \$545.98 SLS PTS RO SVC SHOP SUPPLIES \$60.28 G.S.T. 136235181 \$62.04 \$1,302.85 PLEASE PAY THIS TOTAL

> > PAID APR 2 3 2019 ENTERED APR 1 7 2019

PRIVACY NOTICE

The personal information received from individuals relating to this transaction is collected in accordance with Dealers privacy policy. Its collection, use and disclosure is necessary for the purpose of repair, testing, service or other dealing with the Customers vehicle, for the use of any loaner vehicle. If applicable, and for providing information about other current and future products and services of the dealer, the manufacturer of new vehicles for which the dealer is franchised, and any applicable leasing or financing entity. The individual signing this agreement consents to such collection, use and disclosure. If the individual does not so consent or wishes to withdraw such consent, or if the individual wants a copy of the Dealers privacy policy, the individual must contact the dealers privacy officer.

OUSTOMED, V				DATE	

Hopf Mechanical & Hydraulics

Box 1658 Brooks, AB T1R 1C5

Invoice To

Box 789 Brooks, AB T1R 1B7

Big Steam Oilfield Services

660 Aquaduct Dr

403-501-0190 403-501-8466

ENTERED APR 0 2 2019

Date Invoice # 3/15/2019 9409

Invoice

RECEIVED

MAR 25 2010

W.O. No. P.O. No. Terms 6699 Net 30

admin@hopfmechanical.com

www.hopfmechanical.com

Quantity	Item	Description	Price Each	Amount
10 1 1 1 2 1 1 1 1	REGULAR TIME SHOP BUYOUT BUYOUT BUYOUT BUYOUT 1516-12-12 FREIGHT SHOP	REGULAR TIME SHOP PGP020A346 2" GEAR NPT 329071-19X PTO GASKET AND SEAL KIT 3-P-1050X PTO SHAFT 550439 PTO BEARING CONE 550010 PTO BALL BEARING MALE NPT MALE JIC FREIGHT CHARGE Shop Supplies/Enviro Charges UNIT#33 WATER TRUCK NO HYDRAULICS KM 97530 HOURS 4761 REMOVE FLOW DIVIDER. REBUILD PTO. INSTALL PUMP AND PTO. TEST	115.00 585.00 122.59 652.81 38.01 35.27 2.04 52.94 92.00	1,150.00 585.00 122.59 652.81 76.02 35.27 2.04 52.94 92.00
		PAID APR 23 2019 VP 2 2 2	Subtotal	\$2,768.6

GST/HST No.

822076766

Sales Tax Summary

GST@5.0% Total Tax

138.43 138.43

Total

\$2,907.10



Sold To:

Summit Motors Ltd.



Sold From:

BIG STEAM OILFIELD SERVICES

BOX 789

Box 1630, 140 15th Ave E. Brooks, AB T1R 1C4

Phone: (403) 501-5687 Fax: (403) 501-5684

Since '63



DATE: 03-15-19

Branches: Laber Brooks Med Hat

Ship To:

PARTS INVOICE# B159728

BIG STEAM OILFIELD SERVICES BOX 789

BROOKS, AB T1R 1R7

Page 1 of 1 Auth:

BROOKS, AB T1R 1B7

Samuel Control of	A CONTRACTOR OF THE PERSON NAMED IN CONT							
U	ustomer Acct Numbe	r and a	Phone Number	Salesman	Shir	Via	Customer Purch	oco Ordon
	22093		403 501-5335	DC	The second secon	R PICK UP	UNIT:33	
Loc	Part #	A 2008 A 200	Description	Ord Shi		List	Unit Price	Extension
04C03	1842130C3	THERMOST		1	1	163 0		122 17

RECEIVED MAR 1 6 2019

ENTERED MAR 2 1 2019

PAID APR 2 3 2019

VP234

ALL OVERDUE ACCOUNTS ARE SUBJECT TO A LATE CHARGE OF 2% PER MONTH (26.82% PER ANNUM).

04:29PM X X DC 41A1 PARTS TAX

		Su	o Total	132.17
CUSTOMER SIGNATURE:	DATE:	Free	ight	0.00
	CUSTOMER	Sa	es Tax	0.00
		GS	ī -	6.61
	SIII	Ple 136235181	ase Pay	138.78

PRIVACY NOTICE

The personal information received from individuals relating to this transaction is collected in accordance with Dealers privacy policy. Its collection, use and disclosure is necessary for the purpose of repair, testing, service or other dealing with the Customers vehicle, for the use of any loaner vehicle. If applicable, and for providing information about other current and future products and services of the dealer, the manufacturer of new vehicles for which the dealer is franchised, and any applicable leasing or financing entity. The individual signing this agreement consents to such collection, use and disclosure. If the individual does not so consent or wishes to withdraw such consent, or if the individual wants a copy of the Dealers privacy policy, the individual must contact the dealers privacy officer.

Date: Mar 15/19 Inspecto	r's Name:	Diedrie	ch / Peter		
License Plate Number(s): BTT-	7433	Vel	nicle Unit Number: 33		
Odometer: 97.565 Hou	ur Meter:	4762	in the second se		
gnature: Dichuch Knel	×In-				
SERVICE	Check	Change	SERVICE	Check	Change
Body and Seats (S.1)	/		Wheel Alignment (S. 19)	V	
Chassis Frame (S. 2)	V		C-Dolly Steering (S. 20)	NA	
Body Frame (S. 3)	V		Steering Linkage (S. 21)	/	
Sliding Subframe (S. 4)	NA		Suspension (S. 22)	V	
Underbody (S. 5)	V		General Requirements (S. 23)	V	
Driver Shaft (S. 6)	V		Windshield Wipers and Washers Anti-freeze (S. 24)	V	
Window and Mirrors (S. 7)	V	- 4	Heating and Defrosting System (S. 25)	~	
Fuel (S. 8)	V		Starting Switch (S. 26)	V	
Exhaust (S. 9)	V		Tires (S. 28)	V	
Friction Components (S. 10)	V		Wheels (S. 29)		
Hydraulic & Vacuum-assist Brake Components (S. 11)	NA		Lubrication (S. 30)	V	
Mechanical Components (S. 12)	V		Fifth Wheel Coupling Device (S. 31)	NA	
rake Pedal (S. 13)	V		Trailer Hitch, Mount & Connecting Devices (S. 32)	NA	
Air Brake System (S. 14)	V		Rear Impact Guards (S. 33)	V	
Park Brake (S. 15)	1		Differentials	V	
Brake System (S. 16)	V		Transmission	V	
Engine Controls (S. 17)	V		Air Filter	V	
Steering Column and Box (S. 18)	V		Engine Oil/Filter		V
Back Up Alarm	V		Positive Air Shut Off	V	
	Theck rmosto switch	ted to	Pluids, New HXD Pa anged both Belts,	ump (h	op ()



Customer:

22093

Summit Motors Ltd.





Sold From:

Box 1630, 140 15th Ave E.

Phone: (403) 501-5687 Fax: (403) 501-5684 ENTERED OCT 0 5 2018

Since '63 RECEIVED

OCT 0 5 2018

Taber Branches:

Brooks

Med Hat

BIG STEAM OILFIELD SERVICES

BOX 789

BROOKS, AB T1R 1B7

Ship To:

BIG STEAM OILFIELD SERVICES

INVOICE DATE: 09-26-18 Service Invoice #:

BOX 789

BROOKS, AB T1R 1B7

B14752

CUSTOMER INVOICE

	01-5335	Tax ID Date:	Tax ID:		Page 1 of 1
	MAKE / MODEL	VIN	LICENSE	MILEAGE	AUTH
YEAR		1HTWGAZR7DJ343548	BTT7433	92151	33
2013	NAVISTAR / 7400	ENGINE MODEL / SERIAL #	P.O. NUMBER	COMPLETE	UNIT/STOCK
DEL DATE	OPEN DATE / TIME		33	09-25-18	33
09-13-12	09-21-18 / 04:06PM	MAXXFORCE 9 / 570HM2Y3436056	TRANSMISSION MO		SERVICE WRITER
DEL MILEAGE		MEMO	I KANSMISSION WO	DELISERIAL#	AD*Ad
21		THE HOURS		STBY HOURS	
ENGINE HOURS	4202.0	REEFER HOURS			

CUSTOMER STATES STOP ENGINE LIGHT IS ON

CORRECTION:
Check complaint for stop engine light on, check codes, had code for severe derate due to soot load. Remove DPF and DOC and inspect, found plugged. Clean out DPF and DOC and reinstall with new gaskets. Run truck, heard boost leak, found CAC hose leaking. Remove air cleaner assembly and charge air cooler to intake hose, install new CAC hose. Start truck, retest for boost leaks, no leaks. Perform regen, regen successful. Take for road test to verify repairs, all ok.

TOTAL LABOR 7.1 HRS @ \$129.50 /HOUR = \$919.45

TOTAL PARTS

Qty Part Number	Desc List	Unit E	xtended
 2 2594129C1 1 3857394C1 1 3900706C1	GASKET 32.55 HOSE 166.81 GASKET 39.45	21.08 141.83 25.54	42.16 141.83 25.54
	SHOP SUPPLIES	\$87.35	
 G.S.T REG. NO. 136235	181 5.0 % OF \$1,216.33	= \$60.82	
	SLS RETAIL LABOR SLS PTS RO SVC SHOP SUPPLIES G.S.T. 136235181 PLEASE PAY THIS TOTAL	\$919.45 \$209.53 \$87.35 \$60.82 \$1,277.15	

PAID NOV 19 2018

VPITT

ENTERED OCT 1 2 2018

The personal information received from individuals relating to this transaction is collected in accordance with Dealers privacy policy. Its collection, use and disclosure is necessary for the purpose of repair, testing, service or other dealing with the Customers vehicle, for the use of any loaner vehicle. If applicable, and for providing information about other current and future products and services of the dealer, the manufacturer of new vehicles for which the dealer is franchised, and any applicable leasing or financing entity. The individual signing this agreement consents to such collection, use and disclosure. If the individual does not so consent or wishes to withdraw such consent, or if the individual wants a copy of the Dealers privacy policy, the individual must contact the dealers privacy officer.

CUSTOMER: X

BEARING SPECIALISTS AND A WHOLE LOT MORE

BOX 970, 1160 - 2ND ST WEST BROOKS, ALBERTA TIR 0V5



14-Jun-2018

Page 1 of 1 P.O. # UNIT 32

INVOICE 489306

Buyer:

Ship Via: Salesman: Neil

BUMPER TO BUMPER

Auto Parts Professionals

Sold to: BIGSTOI

BIG STEAM OILFIELD SERVICE

BOX 789

BROOKSALBERTA T1R 1B7

Shipping paid by:

Ship to: SAME

RECEIVED

JUL 0 5 2018

PAID JUL 2 4 2018 Ctta 19364

		Clia					
	Item	Description	Ordered	Shipped	List \$	Unit \$	Extended \$
		DADIATOR CAR	1.00	1.00	11.64	10.11	10.11
TSL-	9T16R	RADIATOR CAP	1.00	1.00	11.57	10.05	10.05
TSL-	9T37	RADIATOR CAP	1.00	1.00		10.00	10.00
	FR	FREIGHT	1.00	1.00	8.30	6.12	6.12
GRO-	45092	RED CLEARANCE LAMP KIT	1.00	1.00	9.48	7.44	7.44
HJU-	SEAL60	SEALALL		1.00	9.01	6.65	6.65
JBW-	8265SCAN	J B WELD ORIGINAL COLD goods and services tax	1.00 1.00	1.00	2.52	2.52	2.52

ENTEDED III 05 2018

Stocked	Non-	Cores	Enviro	Misc	Other Charges	GST	PST	Payments	Document Total
Items	Stocked		Charges	Charges		2.52	0.00	0.00	52.89
40.37	0.00	0.00	0.00	0.00	10.00	2.52	0.00		

REMITTANCE TO LOGAN INDUSTRIES MONDAY - FRIDAY 6:00-5:30PM SATURDAY: 7:00AM-1:00PM **AFTER HOURS CALL 403-362-6208**

AUTHORIZED SIGNATURE


* AUTO * AGRICULTURAL * INDUSTRIAL


SUPPLIES

GST # 802765297 RT

Brooks Car Care Ltd.

Box 2108 Brooks, AB T1R 1C8 MAY 03 2018
RECEIVED

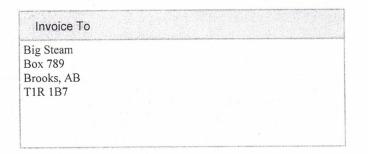

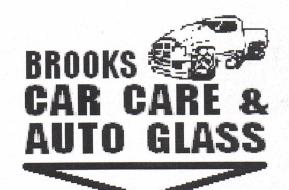

Invoice #

01-24724

Date

4/30/2018

E-mail

BrooksCarCare@Gmail.com

Phone #

403-362-6766

Fax#

403-362-6575

ENTERED MAY 0 8 2018

Description	Qty	Rate	Amount
W1451GTY Windshield Installed hit # 33		327.00	327.00
	PAID JUN 1 R 2018 CHQ 19316		
	CHQ 19316		
GST/HST No. 891233322		GST/HST	\$16.3
Thank You for s	shopping at Brooks Car Care and	Auto Glass!	
		Total	\$343.3

DK

COPY

gnature: Diechich Chner	leen				
SERVICE	Check	Change	SERVICE	Check	Change
Body and Seats (S.1)	V		Wheel Alignment (S. 19)	~	
Chassis Frame (S. 2)	V		C-Dolly Steering (S. 20)	NA	
Body Frame (S. 3)	V		Steering Linkage (S. 21)	V	
Sliding Subframe (S. 4)	NA		Suspension (S. 22)	~	
Inderbody (S. 5)	V		General Requirements (S. 23)	~	
Driver Shaft (S. 6)	V		Windshield Wipers and Washers Anti-freeze (S. 24)	V	
Vindow and Mirrors (S. 7)	V		Heating and Defrosting System (S. 25)	V	
Fuel (S. 8)		V	Starting Switch (S. 26)	V	
Exhaust (S. 9)	V		Tires (S. 28)	V	
riction Components (S. 10)	V		Wheels (S. 29)	V	
Hydraulic & Vacuum-assist Brake Components (S. 11)	NA		Lubrication (S. 30)	V	
Mechanical Components (S. 12)	V		Fifth Wheel Coupling Device (S. 31)	NA	
Prake Pedal (S. 13)	V	24	Trailer Hitch, Mount & Connecting Devices (S. 32)	NA	
Air Brake System (S. 14)	V		Rear Impact Guards (S. 33)	V	
Park Brake (S. 15)	V		Differentials	V	
Brake System (S. 16)	V		Transmission	V	
Engine Controls (S. 17)	V		Air Filter	~	
Steering Column and Box (S. 18)	V		Engine Oil/Filter		V
Back Up Alarm	V		Positive Air Shut Off	V	
NOTES: Greased che	ecked	fluid	s,		

V V VA V V		Wheel Alignment (5, 19) C-Dolly Steering (8, 20) Steering Linkage (8, 21) Suspension (8, 22) General Requirements (8, 23)	NAV	
V VA V V		Steering Linkage (S. 21) Suspension (S. 22)	NAV	
V VA V		Suspension (S. 22)	V	
VAV			V	
VVV		General Requirements (S. 23)	The second secon	
V			V	
V		Windshield Wipers and Washers Anti-freeze (S. 24)	V	
		Heating and Defrosting System (S. 25)	V	
V		Starting Switch (520)	V	
V		Tires (S. 28)	V	
V		Wheels (S. 29)	V	
NA		Lubrication (S. 30)	V	
V		Fifth Wheel Coupling Device (S. 31)	NA	
V		Trailer Hitch, Mount & Connecting Devices (S. 32)	NA	
V		Rear Impact Guards (S. 33)	V	
V		Differentials	V	
V		Transmission	V	
V		Air Filter	V	
1/		Engine Oil/Filter		1 v
V		Positive Air Shut Off	V	
	V VA V V V V V V V V	V V V	Wheels (S. 29) Lubrication (S. 30) Fifth Wheel Coupling Device (S. 31) Trailer Hitch, Mount & Connecting Devices (S. 32) Rear Impact Guards (S. 33) Differentials Transmission Air Filter Engine Oil/Filter	Wheels (S. 29) Lubrication (S. 30) Fifth Wheel Coupling Device (S. 31) I railer Hitch, Mount & Connecting Devices (S. 32) Rear Impact Guards (S. 33) Differentials Transmission Air Filter Positive Air Shut Off